

August 2026 Groundwater Verification Resampling Report

Sandy Creek Energy Station
Coal Combustion Residual Waste
Management Facility
McLennan County, Texas

Prepared For:

Sandy Creek Energy Station
2161 Rattlesnake Road
Riesel, Texas 76682

SCS ENGINEERS

SCS Project 16226010.00 | September 2026

1901 Central Drive, Suite 550
Bedford, TX 76021
817-571-2288

September 24, 2026
SCS Project No. 16226010.00

Mr. Luke Johnson
Compliance Manager
NAES Corporation
2161 Rattlesnake Road
Riesel, Texas 76682

Subject: Sandy Creek Energy Station
McLennan County, Texas
June 2026 First Semiannual Groundwater Monitoring Report

Dear Mr. Johnson:

On behalf of Sandy Creek Energy Station (SCES) Coal Combustion Residual (CCR) Waste Management Facility (Landfill), SCS Engineers (SCS) is submitting these data and analysis for the August 2026 Verification Resampling Report, in accordance with the site Groundwater Sampling and Analysis Plan (GWSAP) prepared by SCS Engineers, dated January 13, 2022, 40 CFR §257.94(e)(2), and 30 TAC §352.941, for a calcium detection in groundwater monitoring well MW-1. During the June 2026 groundwater monitoring event, calcium was detected in MW-1 at 630 mg/L, above the statistical limit of 603.5 mg/L.

GROUNDWATER SAMPLING AND REPORTING FOR AUGUST 2026 RESAMPLING

During the previous sampling event conducted in June 2026, the following unconfirmed statistically significant increase (SSI) occurred: calcium (630 ug/L) in MW-1. Monitoring well MW-1 was purged and sampled on August 18, 2026. Results of the Verification Resampling event are presented in Table 1.

Additionally, on August 18, 2026, three soil samples (S-1, S-2, S-3) were collected using hand auger methods. S-1 and S-2 were collected northeast of MW-1 at depths of 0.5 feet and 1.25 feet respectively and S-3 was collected near MW-3 at 1.25 feet. Locations of soil samples are representative of soil located within the vicinity of MW-1, as well as soil encountered sitewide and are shown on Figure 1. As indicated in Table 1 below, the initial calcium exceedance was not confirmed during the August 2026 Verification Resampling event, therefore, soil samples obtained during the sampling event were not further evaluated. The laboratory page one-threes and the laboratory analytical results are included as an attachment to this report.



Table 1 – August 2026 Verification Resampling Result (mg/L)

MW-ID	Constituent	Initial Result (June 2026)	Resampling Result (Aug 2026)	Statistical Limit	Confirmed SSI?	Proposed Action
MW-1	Calcium	630	460	603.5	No	Continue Detection Monitoring

CLOSING

The initial calcium exceedance in MW-1 was not confirmed during the August 2026 Verification Resampling event; therefore, no further action is recommended for the monitoring well. MW-1 will resume detection monitoring in accordance with 30 TAC §352.941.

The next scheduled monitoring event will be the second semiannual sampling event which will be conducted in the fourth quarter of 2026. Please contact Robert Fowler at (501) 503-4779 if you have comments or require additional information.




Asher Boudreaux, P.G.
Project Professional
SCS ENGINEERS


TBPE Registration No. F-3407



Robert Fowler, P.G.
Project Manager
SCS ENGINEERS

Attachment: Figure 1: Soil Sample Locations
TCEQ Pages One through Three
Laboratory Report, Checklist, and Chains-of-Custody

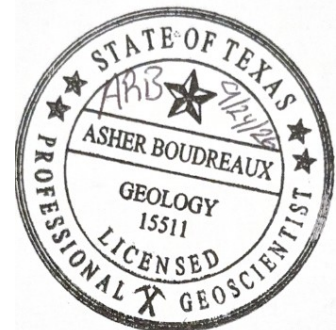

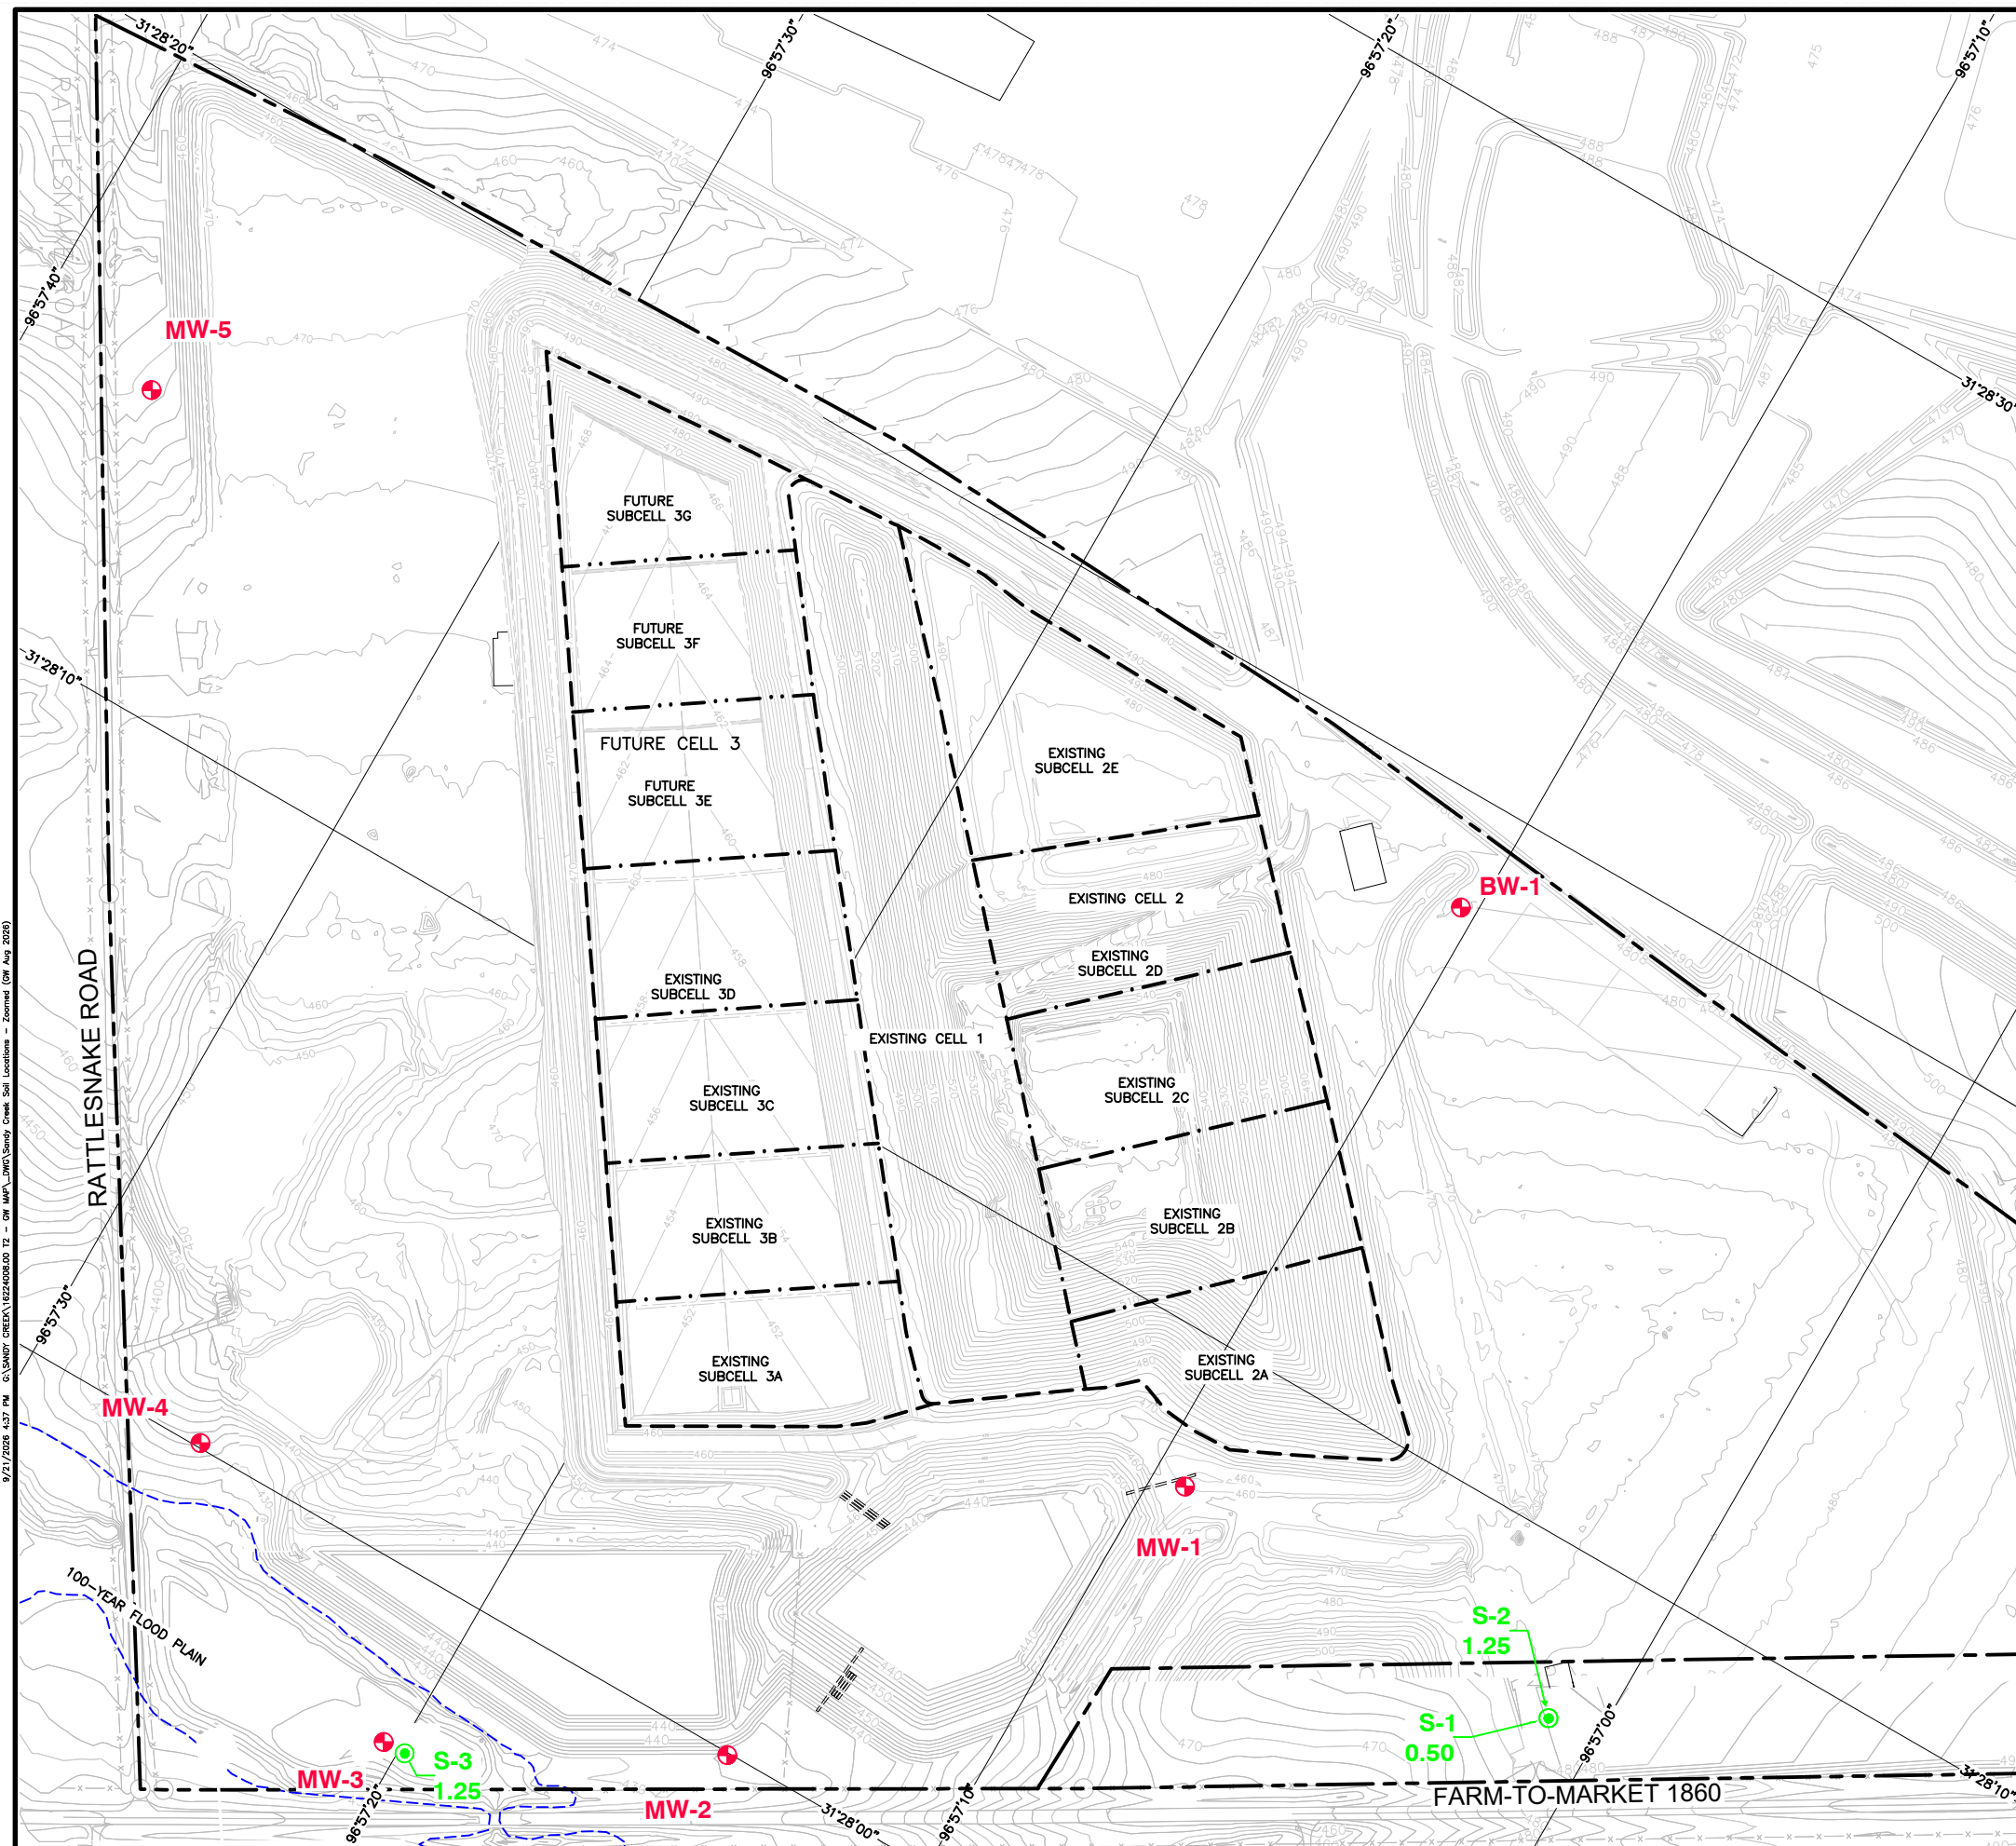

Groundwater Monitoring Form

Facility name: Sandy Creek Energy Station
Permittee: Sandy Creek Energy Associates, L.P.
County: McLennan

1. Facility Type: Power Station
2. Monitor well no.: MW-1
3. Date of sampling: 8/18/2026

Name of sampler: Asher B.
Affiliation of sampler: SCS Engineers
If split sampled, with whom? N/A
Integrity of well: Good
Installation date: 9/21/2015

Most recent previous sampling: 6/10/2026
Date of water level measurements: 8/18/2026
Datum reference point: Top of Casing
Datum elevation*: 465.87
Depth to water(below datum)*: 10.85
4. Water level elevation*: 455.02

5. Purging/Sampling method: Bailer (Enter bailer or pump)
Were low-flow methods used? ☐ yes ☒ no (check one)
If yes, what volume was purged? N/A gal.
6. Well volumes purged: 1.6
7. Was the well dry before purging? ☐ yes ☒ no (check one)
8. Was the well dry after purging? ☒ yes ☐ no (check one)
9. How long before sampling? 2
10. Unit of measure? hours (Enter value as days, hours, or mins.)

11. Sample event: Detection
- Background - Corrective Action
- Detection - Other
- Assessment
12. Sample schedule: Semi-Annual
- Quarterly - Fourth Year
- Semi-Annual - Other
- Annual
13. Sample type: Resample
- Regular - Split
- Duplicate - Other
- Resample

Field Measurements:

14. pH 7.28
15. Spec. cond. 4.89
17. Temp. 29.30
19. Turbidity 8.6

16. ☒ mS/cm
18. ☐ F or ☒ C (check one)
20. ☒ NTU

Laboratory:

21. Name Eurofins Dallas
Address: 9701 Harry Hines Blvd

Phone: (214) 902-0300

Representative's Signature: *Anita Patel*

Date: _____

Site Operator's Signature: *Luke Johnson*

Date: _____

* Report depth to water and elevations to nearest 0.01 foot relative to mean sea level (msl).



Texas Commission on Environmental Quality

Waste Permits Division, Municipal Solid Waste Permits Section

Groundwater Sampling Report

OTHER CONSTITUENTS

MW-1

CONSTITUENT ¹		CONCENTRATION ²	REPORTING LIMIT ^{2,3}	METHOD
Calcium	☒ T ☐ D	460 mg/L	0.60 mg/L	6020B

¹ Indicate whether analyses for Total (T) or Dissolved (D); use two pages if both are run. If analyses for dissolved concentrations, indicate filter pore size [] 0.45, [] 1, [] 10, [] ____ micron, and whether filtered [] in field or [] in laboratory.

² Indicate if reporting limits are ____X PQL's or ____MDL's

³ Show units of concentration and reporting limit.



Texas Commission on Environmental Quality

Waste Permits Division, Municipal Solid Waste Permits Section

Groundwater Sampling Report

OTHER CONSTITUENTS

S-1

CONSTITUENT			CONCENTRATION		REPORTING LIMIT	METHOD
Calcium	☐	D	71000	mg/Kg	290	6020B

¹ Indicate whether analyses for Total (T) or Dissolved (D); use two pages if both are run. If analyses for dissolved concentrations, indicate filter pore size [] 0.45, [] 1, [] 10, [] ____ micron, and whether filtered [] in field or [] in laboratory.

² Indicate if reporting limits are ____X PQL's or ____MDL's

³ Show units of concentration and reporting limit.



Texas Commission on Environmental Quality

Waste Permits Division, Municipal Solid Waste Permits Section

Groundwater Sampling Report

OTHER CONSTITUENTS

S-2

CONSTITUENT ¹		CONCENTRATION ²	REPORTING LIMIT ^{2,3}	METHOD
Calcium	☒ T ☐ D	120000 mg/Kg	270 mg/Kg	6020B

¹ Indicate whether analyses for Total (T) or Dissolved (D); use two pages if both are run. If analyses for dissolved concentrations, indicate filter pore size [] 0.45, [] 1, [] 10, [] ____ micron, and whether filtered [] in field or [] in laboratory.

² Indicate if reporting limits are ____X PQL's or ____MDL's

³ Show units of concentration and reporting limit.



Texas Commission on Environmental Quality

Waste Permits Division, Municipal Solid Waste Permits Section

Groundwater Sampling Report

OTHER CONSTITUENTS

S-3

CONSTITUENT ¹		CONCENTRATION ²	REPORTING LIMIT ^{2,3}	METHOD
Calcium	☒ T ☐ D	19000 mg/Kg	250 mg/Kg	6020B

¹ Indicate whether analyses for Total (T) or Dissolved (D); use two pages if both are run. If analyses for dissolved concentrations, indicate filter pore size [] 0.45, [] 1, [] 10, [] ____ micron, and whether filtered [] in field or [] in laboratory.

² Indicate if reporting limits are ____X PQL's or ____MDL's

³ Show units of concentration and reporting limit.

ANALYTICAL REPORT

PREPARED FOR

Attn: Asher Boudreaux
SCS Engineers
1901 Central Avenue
Suite 550
Bedford, Texas 76021

Generated 8/27/2026 12:29:01 PM

JOB DESCRIPTION

Sandy Creek LF Verification Resample

JOB NUMBER

870-50173-1


Eurofins Dallas

Job Notes

This report may not be reproduced except in full, and with written approval from the laboratory. The results relate only to the samples tested. For questions please contact the Project Manager at the e-mail address or telephone number listed on this page.

Analytical test results meet all requirements of the associated regulatory program (i.e., NELAC (TNI), DoD, and ISO 17025) unless otherwise noted under the individual analysis.

Authorization



Generated
8/27/2026 12:29:01 PM

Authorized for release by
Anita Patel, Project Manager
Anita.Patel@et.eurofinsus.com
(832)776-2275

Table of Contents

Cover Page	1
Table of Contents	3
Definitions/Glossary	4
Case Narrative	5
Client Sample Results	6
QC Sample Results	7
QC Association Summary	9
Lab Chronicle	11
Certification Summary	13
Method Summary	14
Sample Summary	15
Chain of Custody	16
Receipt Checklists	17



Definitions/Glossary

Client: SCS Engineers

Job ID: 870-50173-1

Project/Site: Sandy Creek LF Verification Resample

Qualifiers

Metals

Qualifier	Qualifier Description
4	MS, MSD: The analyte present in the original sample is greater than 4 times the matrix spike concentration; therefore, control limits are not applicable.

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
☼	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: SCS Engineers
Project: Sandy Creek LF Verification Resample

Job ID: 870-50173-1

Job ID: 870-50173-1

Eurofins Dallas

Job Narrative 870-50173-1

The analytical test results presented in this report meet all requirements of the associated regulatory program listed on the Accreditation/Certification Summary Page, unless otherwise noted. Data qualifiers and/or narrative comments are included to explain any exceptions, if applicable. Regulated compliance samples (e.g. SDWA, NPDES) must comply with associated agency requirements/permits.

- Matrix-specific batch QC (e.g., MS, MSD, SD) may not be reported when insufficient sample volume is available or when site-specific QC samples are not submitted. In such cases, a Laboratory Control Sample Duplicate (LCSD) may be analyzed to provide precision data for the batch.
- For samples analyzed using surrogate and/or isotope dilution analytes, any recoveries falling outside of established acceptance criteria are re-prepared and/or re-analyzed to confirm results, unless the deviation is due to sample dilution or otherwise explained in the case narrative.

Receipt

The samples were received on 8/19/2026 11:02 AM. Unless otherwise noted below, the samples arrived in good condition, and, where required, properly preserved and on ice. The temperature of the cooler at receipt time was 1.5°C.

Metals

Method 6020B: The matrix spike / matrix spike duplicate (MS/MSD) recoveries for preparation batch 860-356129 and analytical batch 860-356935 were outside control limits. Sample matrix interference is suspected because the associated laboratory control sample (LCS) recovery was within acceptance limits.

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

General Chemistry

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

Eurofins Dallas

Client Sample Results

Client: SCS Engineers
Project/Site: Sandy Creek LF Verification Resample

Job ID: 870-50173-1

Client Sample ID: MW-1

Lab Sample ID: 870-50173-1

Date Collected: 08/18/26 14:30

Matrix: Water

Date Received: 08/19/26 11:02

Method: SW846 6020B - Metals (ICP/MS)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Calcium	460		0.60	0.60	mg/L		08/24/26 13:36	08/26/26 15:10	20

Client Sample ID: S-1

Lab Sample ID: 870-50173-2

Date Collected: 08/18/26 13:20

Matrix: Solid

Date Received: 08/19/26 11:02

Percent Solids: 96.5

Method: SW846 6020B - Metals (ICP/MS)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Calcium	71000		290	290	mg/Kg	☆	08/24/26 21:56	08/26/26 18:12	50

Client Sample ID: S-2

Lab Sample ID: 870-50173-3

Date Collected: 08/18/26 13:25

Matrix: Solid

Date Received: 08/19/26 11:02

Percent Solids: 96.9

Method: SW846 6020B - Metals (ICP/MS)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Calcium	120000		270	270	mg/Kg	☆	08/24/26 21:56	08/26/26 18:18	50

Client Sample ID: S-3

Lab Sample ID: 870-50173-4

Date Collected: 08/18/26 13:30

Matrix: Solid

Date Received: 08/19/26 11:02

Percent Solids: 88.8

Method: SW846 6020B - Metals (ICP/MS)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Calcium	19000		250	250	mg/Kg	☆	08/24/26 21:56	08/26/26 18:15	50

QC Sample Results

Client: SCS Engineers
Project/Site: Sandy Creek LF Verification Resample

Job ID: 870-50173-1

Method: 6020B - Metals (ICP/MS)

Lab Sample ID: MB 860-355941/1-A

Matrix: Water

Analysis Batch: 356935

Client Sample ID: Method Blank

Prep Type: Total/NA

Prep Batch: 355941

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Calcium	ND		0.10	0.030	mg/L		08/24/26 13:36	08/26/26 14:29	1

Lab Sample ID: LCS 860-355941/2-A

Matrix: Water

Analysis Batch: 356935

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Prep Batch: 355941

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Calcium	2.50	2.31		mg/L		92	80 - 120

Lab Sample ID: LCSD 860-355941/3-A

Matrix: Water

Analysis Batch: 356935

Client Sample ID: Lab Control Sample Dup

Prep Type: Total/NA

Prep Batch: 355941

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Calcium	2.50	2.31		mg/L		92	80 - 120	0	20

Lab Sample ID: MB 860-356129/1-A

Matrix: Solid

Analysis Batch: 356935

Client Sample ID: Method Blank

Prep Type: Total/NA

Prep Batch: 356129

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Calcium	ND		10	5.8	mg/Kg		08/24/26 21:56	08/26/26 16:43	1

Lab Sample ID: LCS 860-356129/2-A

Matrix: Solid

Analysis Batch: 356935

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Prep Batch: 356129

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Calcium	240	217		mg/Kg		90	80 - 120

Lab Sample ID: LCSD 860-356129/3-A

Matrix: Solid

Analysis Batch: 356935

Client Sample ID: Lab Control Sample Dup

Prep Type: Total/NA

Prep Batch: 356129

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Calcium	245	224		mg/Kg		91	80 - 120	3	20

Lab Sample ID: 860-160537-A-7-B MS

Matrix: Solid

Analysis Batch: 356935

Client Sample ID: Matrix Spike

Prep Type: Total/NA

Prep Batch: 356129

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Calcium	40000		223	38600	4	mg/Kg		-532	75 - 125

Lab Sample ID: 860-160537-A-7-C MSD

Matrix: Solid

Analysis Batch: 356935

Client Sample ID: Matrix Spike Duplicate

Prep Type: Total/NA

Prep Batch: 356129

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Calcium	40000		223	39400	4	mg/Kg		-148	75 - 125	2	20

Eurofins Dallas

QC Sample Results

Client: SCS Engineers
Project/Site: Sandy Creek LF Verification Resample

Job ID: 870-50173-1

Method: 6020B - Metals (ICP/MS)

Lab Sample ID: 860-160455-A-51-D MS

Matrix: Water

Analysis Batch: 356935

Client Sample ID: Matrix Spike

Prep Type: TCLP

Prep Batch: 355941

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Calcium	0.93		2.50	3.32		mg/L		96	75 - 125

Lab Sample ID: 860-160455-A-51-E MSD

Matrix: Water

Analysis Batch: 356935

Client Sample ID: Matrix Spike Duplicate

Prep Type: TCLP

Prep Batch: 355941

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Calcium	0.93		2.50	3.42		mg/L		100	75 - 125	3	20

QC Association Summary

Client: SCS Engineers
Project/Site: Sandy Creek LF Verification Resample

Job ID: 870-50173-1

Metals

Leach Batch: 355543

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
860-160455-A-51-D MS	Matrix Spike	TCLP	Water	1311	
860-160455-A-51-E MSD	Matrix Spike Duplicate	TCLP	Water	1311	

Prep Batch: 355941

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
870-50173-1	MW-1	Total/NA	Water	3010A	
MB 860-355941/1-A	Method Blank	Total/NA	Water	3010A	
LCS 860-355941/2-A	Lab Control Sample	Total/NA	Water	3010A	
LCSD 860-355941/3-A	Lab Control Sample Dup	Total/NA	Water	3010A	
860-160455-A-51-D MS	Matrix Spike	TCLP	Water	3010A	355543
860-160455-A-51-E MSD	Matrix Spike Duplicate	TCLP	Water	3010A	355543

Prep Batch: 356129

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
870-50173-2	S-1	Total/NA	Solid	3051A	
870-50173-3	S-2	Total/NA	Solid	3051A	
870-50173-4	S-3	Total/NA	Solid	3051A	
MB 860-356129/1-A	Method Blank	Total/NA	Solid	3051A	
LCS 860-356129/2-A	Lab Control Sample	Total/NA	Solid	3051A	
LCSD 860-356129/3-A	Lab Control Sample Dup	Total/NA	Solid	3051A	
860-160537-A-7-B MS	Matrix Spike	Total/NA	Solid	3051A	
860-160537-A-7-C MSD	Matrix Spike Duplicate	Total/NA	Solid	3051A	

Analysis Batch: 356935

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
870-50173-1	MW-1	Total/NA	Water	6020B	355941
870-50173-2	S-1	Total/NA	Solid	6020B	356129
870-50173-3	S-2	Total/NA	Solid	6020B	356129
870-50173-4	S-3	Total/NA	Solid	6020B	356129
MB 860-355941/1-A	Method Blank	Total/NA	Water	6020B	355941
MB 860-356129/1-A	Method Blank	Total/NA	Solid	6020B	356129
LCS 860-355941/2-A	Lab Control Sample	Total/NA	Water	6020B	355941
LCS 860-356129/2-A	Lab Control Sample	Total/NA	Solid	6020B	356129
LCSD 860-355941/3-A	Lab Control Sample Dup	Total/NA	Water	6020B	355941
LCSD 860-356129/3-A	Lab Control Sample Dup	Total/NA	Solid	6020B	356129
860-160455-A-51-D MS	Matrix Spike	TCLP	Water	6020B	355941
860-160455-A-51-E MSD	Matrix Spike Duplicate	TCLP	Water	6020B	355941
860-160537-A-7-B MS	Matrix Spike	Total/NA	Solid	6020B	356129
860-160537-A-7-C MSD	Matrix Spike Duplicate	Total/NA	Solid	6020B	356129

General Chemistry

Analysis Batch: 355524

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
870-50173-2	S-1	Total/NA	Solid	Moisture	
870-50173-3	S-2	Total/NA	Solid	Moisture	
870-50173-4	S-3	Total/NA	Solid	Moisture	
MB 860-355524/1	Method Blank	Total/NA	Solid	Moisture	
870-50173-4 DU	S-3	Total/NA	Solid	Moisture	

Eurofins Dallas

QC Association Summary

Client: SCS Engineers
Project/Site: Sandy Creek LF Verification Resample

Job ID: 870-50173-1

General Chemistry

Analysis Batch: 356352

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
MB 860-356352/1	Method Blank	Total/NA	Solid	Moisture	
870-50173-4 DU	S-3	Total/NA	Solid	Moisture	

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13

Lab Chronicle

Client: SCS Engineers
Project/Site: Sandy Creek LF Verification Resample

Job ID: 870-50173-1

Client Sample ID: MW-1

Date Collected: 08/18/26 14:30

Date Received: 08/19/26 11:02

Lab Sample ID: 870-50173-1

Matrix: Water

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	3010A			50 mL	50 mL	355941	08/24/26 13:36	MD	EET HOU
Total/NA	Analysis	6020B		20			356935	08/26/26 15:10	DP	EET HOU

Client Sample ID: S-1

Date Collected: 08/18/26 13:20

Date Received: 08/19/26 11:02

Lab Sample ID: 870-50173-2

Matrix: Solid

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	Moisture		1			355524	08/21/26 18:41	DW	EET HOU

Client Sample ID: S-1

Date Collected: 08/18/26 13:20

Date Received: 08/19/26 11:02

Lab Sample ID: 870-50173-2

Matrix: Solid

Percent Solids: 96.5

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	3051A			0.53 g	50 mL	356129	08/24/26 21:56	PB	EET HOU
Total/NA	Analysis	6020B		50			356935	08/26/26 18:12	DP	EET HOU

Client Sample ID: S-2

Date Collected: 08/18/26 13:25

Date Received: 08/19/26 11:02

Lab Sample ID: 870-50173-3

Matrix: Solid

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	Moisture		1			355524	08/21/26 18:41	DW	EET HOU

Client Sample ID: S-2

Date Collected: 08/18/26 13:25

Date Received: 08/19/26 11:02

Lab Sample ID: 870-50173-3

Matrix: Solid

Percent Solids: 96.9

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	3051A			0.57 g	50 mL	356129	08/24/26 21:56	PB	EET HOU
Total/NA	Analysis	6020B		50			356935	08/26/26 18:18	DP	EET HOU

Client Sample ID: S-3

Date Collected: 08/18/26 13:30

Date Received: 08/19/26 11:02

Lab Sample ID: 870-50173-4

Matrix: Solid

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	Moisture		1			355524	08/21/26 18:41	DW	EET HOU

Lab Chronicle

Client: SCS Engineers
Project/Site: Sandy Creek LF Verification Resample

Job ID: 870-50173-1

Client Sample ID: S-3
Date Collected: 08/18/26 13:30
Date Received: 08/19/26 11:02

Lab Sample ID: 870-50173-4
Matrix: Solid
Percent Solids: 88.8

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	3051A			0.67 g	50 mL	356129	08/24/26 21:56	PB	EET HOU
Total/NA	Analysis	6020B		50			356935	08/26/26 18:15	DP	EET HOU

Laboratory References:
EET HOU = Eurofins Houston, 4145 Greenbriar Dr, Stafford, TX 77477, TEL (281)240-4200

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13

Accreditation/Certification Summary

Client: SCS Engineers

Job ID: 870-50173-1

Project/Site: Sandy Creek LF Verification Resample

Laboratory: Eurofins Houston

All accreditations/certifications held by this laboratory are listed. Not all accreditations/certifications are applicable to this report.

Authority	Program	Identification Number	Expiration Date
Arkansas DEQ	State	88-00759	08-04-27
Florida	NELAP	E871002	06-30-27
Louisiana (All)	NELAP	03054	06-30-27
New Mexico	State	TX00122	06-30-27
Oklahoma	NELAP	1306	12-31-26
Oregon	NELAP	4213-001	03-30-27
Texas	NELAP	T104704215	06-30-27
Texas	NELAP	T104704265	07-31-27
Texas	TCEQ Water Supply	T104704215	11-24-28
USDA	US Federal Programs	525-23-79-79507R1	04-10-29
Washington	State	C1114-26	03-22-27

Method Summary

Client: SCS Engineers

Job ID: 870-50173-1

Project/Site: Sandy Creek LF Verification Resample

Method	Method Description	Protocol	Laboratory
6020B	Metals (ICP/MS)	SW846	EET HOU
Moisture	Percent Moisture	EPA	EET HOU
3010A	Preparation, Total Metals	SW846	EET HOU
3051A	Preparation, Metals, Microwave Assisted	SW846	EET HOU

Protocol References:

EPA = US Environmental Protection Agency

SW846 = "Test Methods For Evaluating Solid Waste, Physical/Chemical Methods", Third Edition, November 1986 And Its Updates.

Laboratory References:

EET HOU = Eurofins Houston, 4145 Greenbriar Dr, Stafford, TX 77477, TEL (281)240-4200

Sample Summary

Client: SCS Engineers
Project/Site: Sandy Creek LF Verification Resample

Job ID: 870-50173-1

Lab Sample ID	Client Sample ID	Matrix	Collected	Received	Sample Origin
870-50173-1	MW-1	Water	08/18/26 14:30	08/19/26 11:02	Texas
870-50173-2	S-1	Solid	08/18/26 13:20	08/19/26 11:02	Texas
870-50173-3	S-2	Solid	08/18/26 13:25	08/19/26 11:02	Texas
870-50173-4	S-3	Solid	08/18/26 13:30	08/19/26 11:02	Texas

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13

Phone (214) 902-0300

 eurofins

870-50173 Chain of Custody

Login Sample Receipt Checklist

Client: SCS Engineers

Job Number: 870-50173-1

Login Number: 50173

List Source: Eurofins Dallas

List Number: 1

Creator: Stoaks, Miya L

Question	Answer	Comment
Radioactivity wasn't checked or is $\leq$ background as measured by a survey meter.	True	
The cooler's custody seal, if present, is intact.	N/A	
Sample custody seals, if present, are intact.	N/A	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the containers received and the COC.	True	
Samples are received within Holding Time (excluding tests with immediate HTs)	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified.	True	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
Containers requiring zero headspace have no headspace or bubble is $<6\text{mm}$ (1/4").	N/A	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Residual Chlorine Checked.	True	

Login Sample Receipt Checklist

Client: SCS Engineers

Job Number: 870-50173-1

Login Number: 50173

List Number: 2

Creator: Marrero, Misleydis

List Source: Eurofins Houston

List Creation: 08/20/26 11:25 AM

Question	Answer	Comment
The cooler's custody seal, if present, is intact.	True	
Sample custody seals, if present, are intact.	N/A	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the containers received and the COC.	True	
Samples are received within Holding Time (excluding tests with immediate HTs)	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified.	True	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
Containers requiring zero headspace have no headspace or bubble is <6mm (1/4").	True	